


RNAV (GPS) RWY 5
DONALDSON FLD (GYH)

T Baro-VNAV and VDP NA when using Greer altimeter setting. For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. When local altimeter setting not received, use Greer altimeter setting and increase LPV DA to 1185 feet; increase LNAV/VNAV DA to 1279; increase all MDAs 40 feet and LNAV visibility Cats C and D ½ SM. For non IAPs, increase LNAV/VNAV visibility all Cats to ½ SM and increase LNAV visibility Cats C/D to 1 ½ SM.

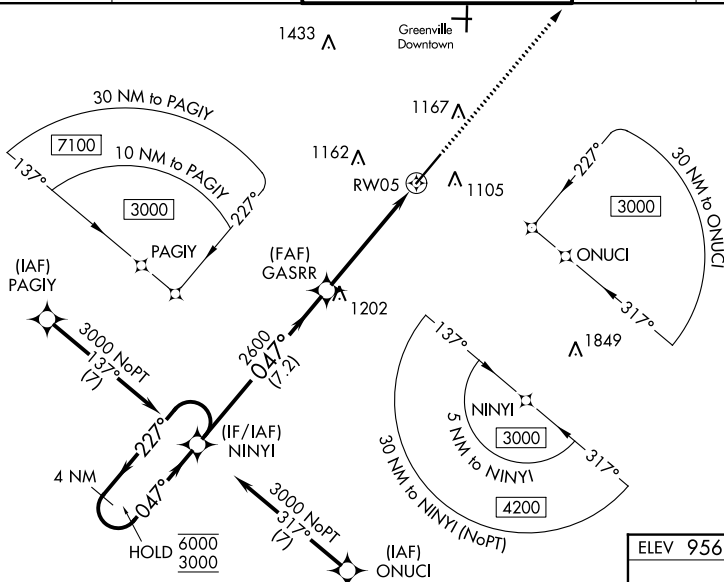

MISSED APPROACH:
Climb to 3000 direct
ILEYO and hold.

UNICOM
122.7



MISSED APCH FIX

 Δ_{1988}


TDZE 956

4 NM
Holding Pattern

VGSI and RNAV glidepath not coincident.
NINYI (VGSI Angle 3.22/TCH 56).

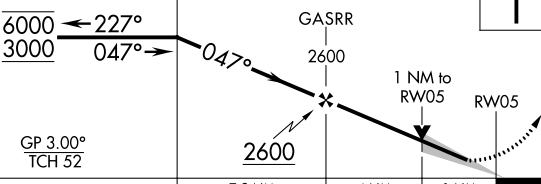

CATEGORY		A	B	C	D
LPV	DA	1156-1/2 200 (200-1/2)			
RNAV/ VNAV	DA	1250-1/2 294 (300-1/2)			
RNAV	MDA	1360-1/2 404 (500-1/2)	1360-3/4 404 (500-3/4)		
CIRCLING		1420-1 464 (500-1)	1480-1 524 (600-1)	1480-1 1/2 524 (600-1 1/2)	1520-2 564 (600-2)

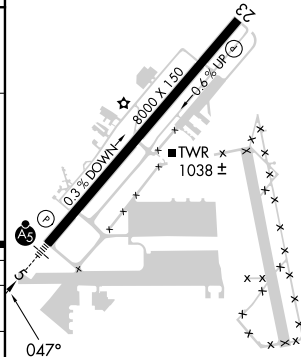HIRL Rwy 5-23 **L**

SE-2, 18 APR 2024 to 16 MAY 2024