

VOR/DME or TACAN RWY 10

VORTAC SYA 109.0 Chan 27	APCH CRS 092°	Rwy Idg 10,004 TDZE 98 Arprt Elev 98
--------------------------------	------------------	--

AL-1246 [USAF]

EARECKSON AS (PASY)


* When ALS inop, increase CAT AB vis to 1½ miles;
CAT CDE vis to 1½ miles.
** Circling Not Authorized in area N of Rwy 10-28.



MISSED APPROACH: Climb to 1200, then climbing right turn to 4200, intercept SYA R-272 direct EMLAW and hold.

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 352.05
---------------------------------	----------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

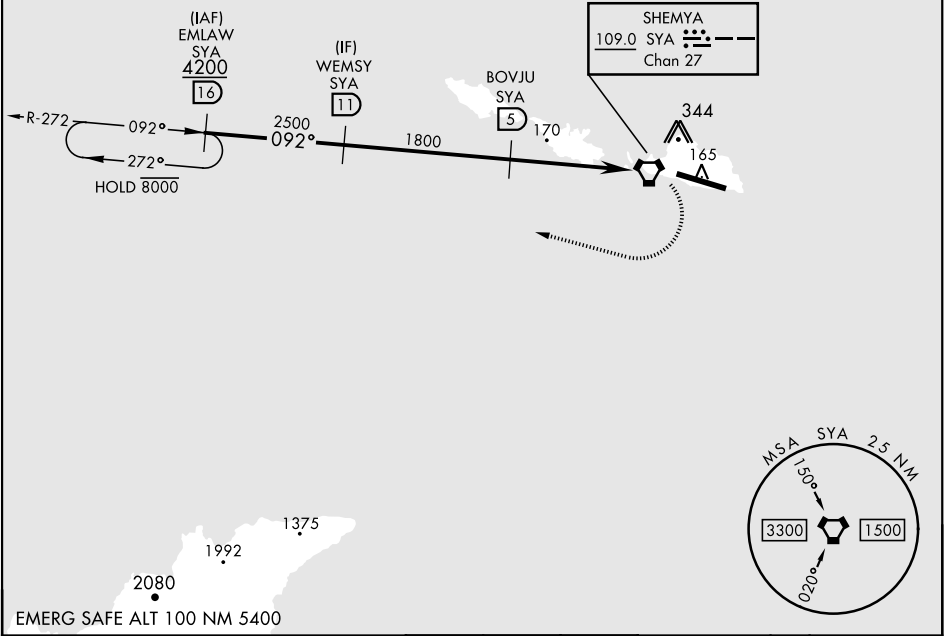

WEMS 11 2500 092° BOVJU 5 1800 2.56° TCH 42 4.9 NM ELVEK 0.8 0.1 VORTAC 1200 4200 EMLAW R-272 16						ELEV 98	TDZE 98
CATEGORY	A	B	C	D	E	101 092° 10,004 x 150 TWR 28	
S-10 *	640-1	542 (600-1)	640-1½	542 (600-1½)			
CIRCLING **	640-1½	542 (600-1½)	640-1½ 542 (600-1½)	660-2 562 (600-2)	680-2 582 (600-2)		
						HIRL Rwy 10-28 REIL Rwy 10 and 28	

VOR/DME or TACAN RWY 10