

VORTAC MHZ
113.2
Chan **79**

APP CRS
349°

Rwy Idg
TDZE
Apt Elev
8500
346
346

VOR/DME or TACAN RWY 34R



JACKSON-MEDGAR WILEY EVERS INTL (JAN)

⚠

When local altimeter setting not received, use Hawkins Fld altimeter setting and increase all MDA 20 feet; increase S-34R Cats C/D/E visibility ½ mile. Circling NA for Cat E southwest of Rwy 16R-34L. Helicopter visibility reduction below ¾ SM NA.

MISSED APPROACH: Climbing right turn to 3000 on heading 120° and MHZ VORTAC R-134 to RAKIN INT/ MHZ 16.5 DME and hold.

ATIS 121.05	JACKSON APP CON★ 123.9 317.7	JACKSON TOWER★ 120.9 (CTAF) 0 352.0	GND CON 121.7 348.6	UNICOM 122.95
-----------------------	--	---	-------------------------------	-------------------------

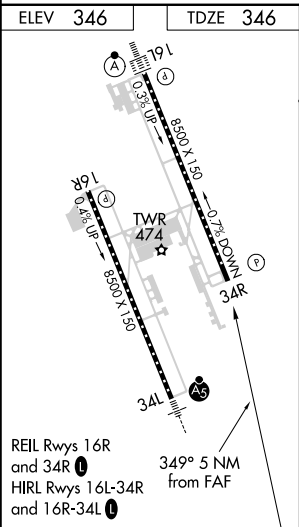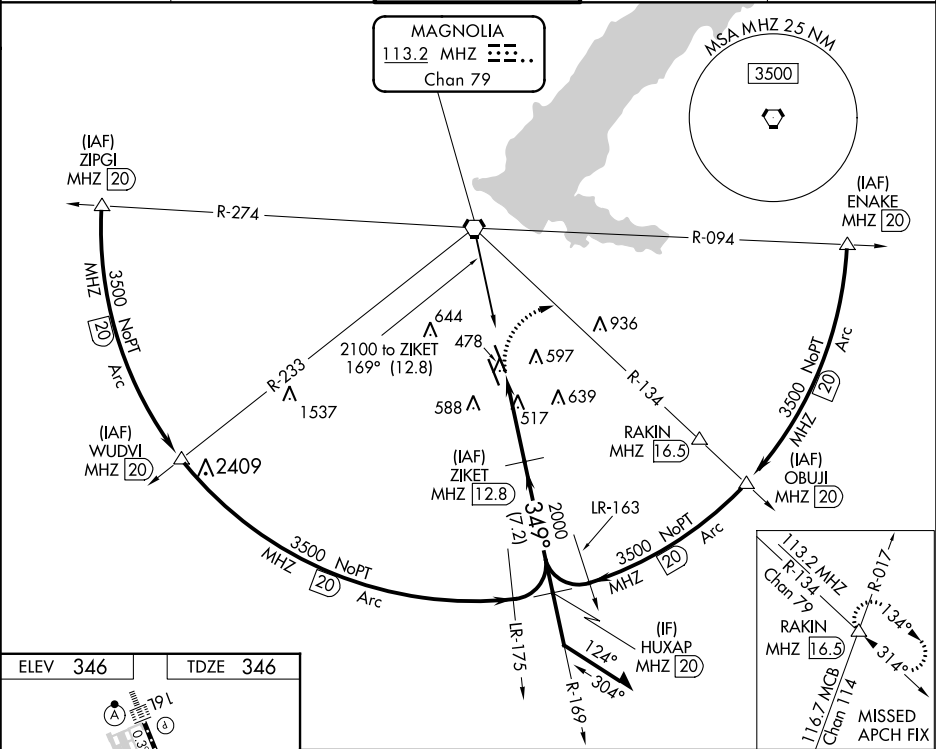

3000	MHZ R-134	RAKIN	ZIKET MHZ 12.8			Remain within 15 NM		
hdg 120°		△						
			2100					
			349°					
			2000					
			2.99° TCH 66					
			5 NM					
CATEGORY	A	B	C	D	E			
S-34R	920/55	574 (600-1)	920-1½	574 (600-1½)				
CIRCLING	920-1	574 (600-1)	920-1½ 574 (600-1½)	960-2 614 (700-2)	1040-2½ 694 (700-2½)			