

24081

ILS or LOC RWY 10
HARTSFIELD-JACKSON ATLANTA INTL (ATL)


ALSF-2

MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 on heading 120° and AHN R-222 to IHOPE/AHN 36 DME and hold.



T Simultaneous approach authorized with Rwy 9L or 8R or 8L, or Rwy 9L and 8L.
 Localizer not suitable for electronic rollout guidance.

D-ATIS	ATLANTA	ATLANTA TOWER						GND CON				
APP 119.65	APP CON	8L-26R	8R-26L	9L-27R	9R-27L	10-28	ALL RWYS	(8L-26R,8R-26L)	(9L-27R,9R-27L)	ALL RWYS		
DER 125.55	127.9	379.9	119.1	125.325	123.85	119.3	119.5	254.4	121.9	121.75	121.65	254.4

CLNC DEL 118.1	CPDLC
-----------------------------	-------

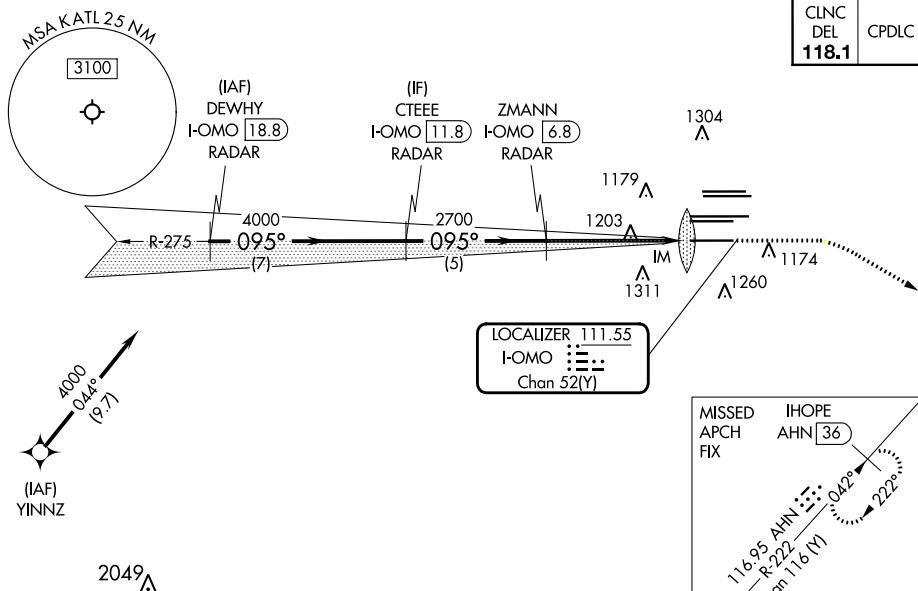

ELEV	1026	D	TDZE	1000
------	------	----------	------	------

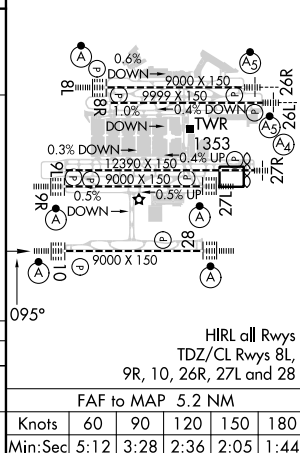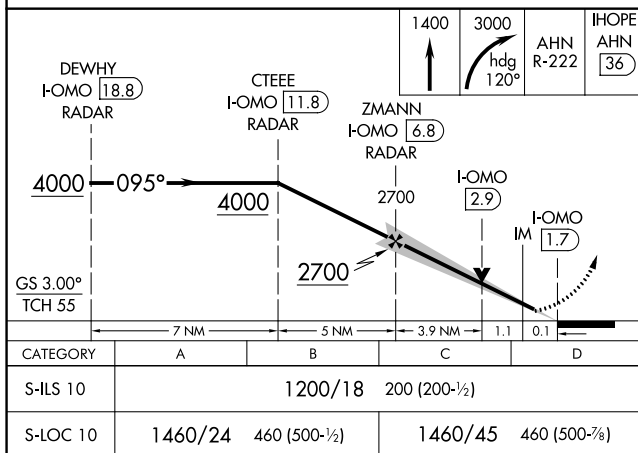

HARTSFIELD-JACKSON ATLANTA INTL (ATL)
33°38'N-84°26'W
ILS or LOC RWY 10