


APP CRS <b>276°</b>	Rwy Idg <b>8394</b> TDZE <b>7</b> Apt Elev <b>65</b>
------------------------	--

# RNAV (RNP) Z RWY 28R

FORT LAUDERDALE/HOLLYWOOD INTL (FLL)

RNP AR APCH - GPS. RADAR required.		MALSR 	MISSED APPROACH: Climb to 800 then climbing right turn to 4000 direct HUKUK and hold, continue climb-in-hold to 4000.		
▼ Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below 7°C or above 54°C. For inop ALS, increase RNP 0.15 visibility to RVR 5500 and increase RNP 0.30 visibility to 1¾ SM.			D-ATIS <b>135.0</b>	MIAMI APP CON <b>133.775 285.6</b>	FORT LAUDERDALE TOWER <b>119.3 257.8</b>
			GND CON <b>121.4</b>	CLNC DEL <b>128.4</b>	CPDLC

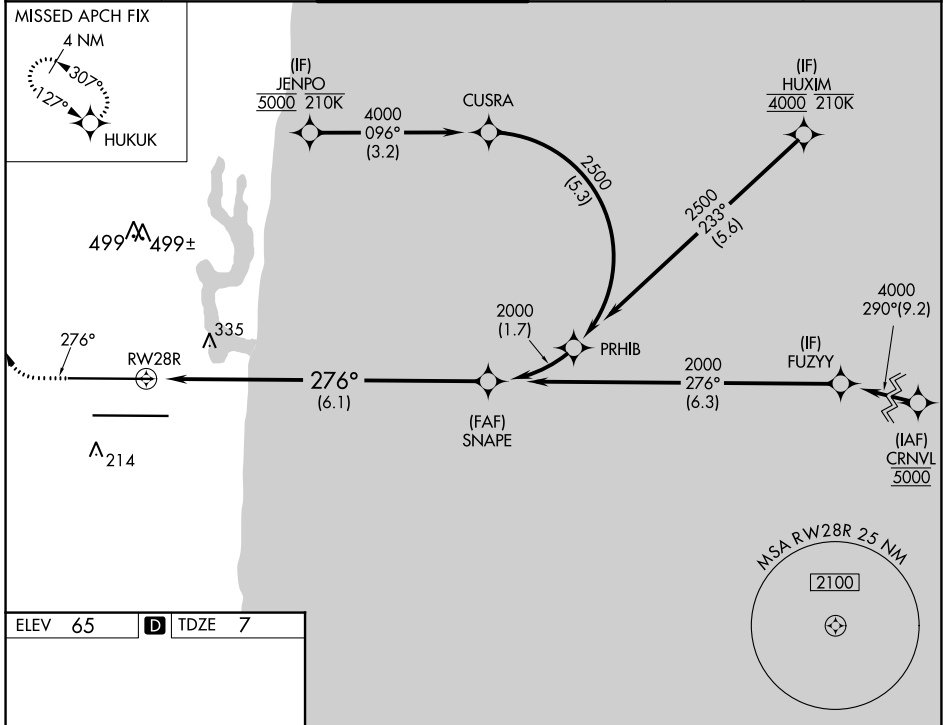

ELEV 65	<b>D</b> TDZE 7
---------	-----------------

HIRL Rwy 10L-28R and 10R-28L

800 4000 HUKUK

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 69).

See planview for multiple IF locations.

CATEGORY	A	B	C	D
RNP 0.15 DA		362/40	355 (300-¾)	
RNP 0.30 DA		618-1⅓	611 (600-1⅓)	

**AUTHORIZATION REQUIRED**

SE-3, 03 OCT 2024 to 31 OCT 2024

SE-3, 03 OCT 2024 to 31 OCT 2024