

BUFFALO, NEW YORK

AL-65 (FAA)

23110

APP CRS	Rwy Idg	7569
235°	TDZE	726
	Apt Elev	727

Rwy Idg	7569
TDZE	726
Apt Elev	727

TDZE 726

Apt Elev **727**

RNAV (RNP) Z RWY 23

BUFFALO NIAGARA INTL (BUF)

RNP AR APCH.

For uncompensated Baro-VNAV systems, procedure NA below -18°C or above 54°C . For inop ALSF, increase RNP 0.10 all Cats visibility to $1\frac{1}{2}$. For inop ALSF, increase RNP 0.20 all Cats visibility to $1\frac{1}{2}$. For inop ALSF, increase RNP 0.30 all Cats visibility to $1\frac{3}{4}$.

ALSF-2



MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to WABUS and hold.

D-ATIS
135.35


BUFFALO APP CON
126.15 263.125

BUFFALO TOWER
120.5 257.8

GND CON
133.2 257.8

CLNC DEL
124.7 257.8

CPDLC

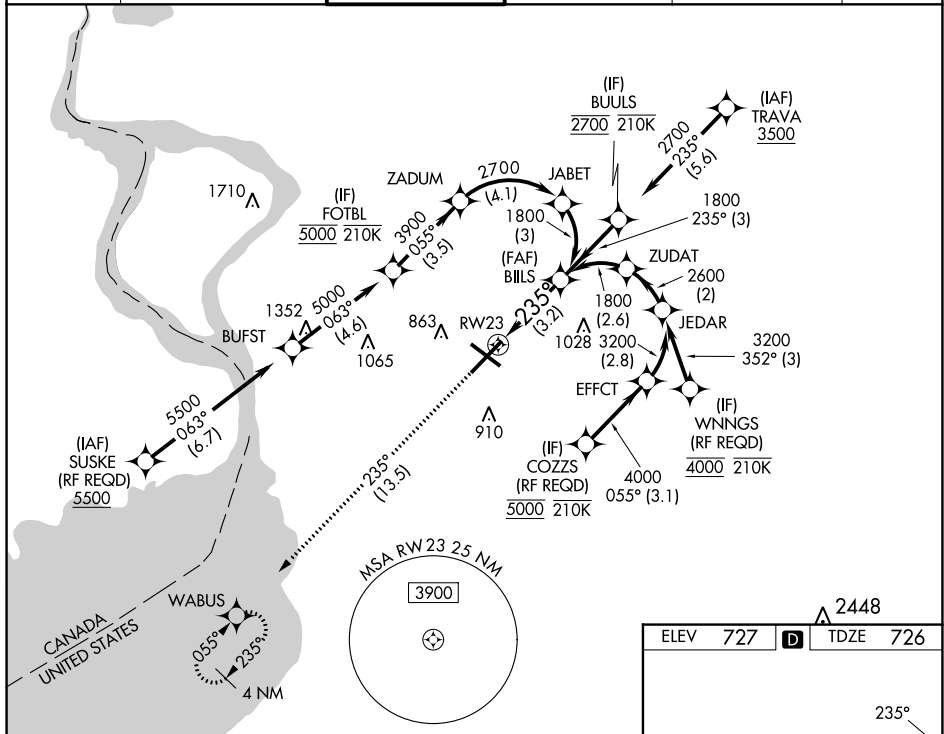

3000
↑
tr 235



See planview for multiple IF locations.

RW23

BILS


1800

GP 3.00°
TCH 51

2 NM —————

CATEGORY	A	B	C	D
RNP 0.10 DA		1114/45	388 (400-7%)	
RNP 0.20 DA		1170/55	444 (500-1)	
RNP 0.30 DA		1228-1¼	502 (600-1¼)	

AUTHORIZATION REQUIRED

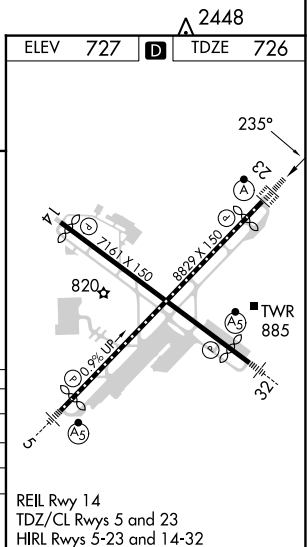

REIL Rwy 14
TDZ/CL Rwy 5 and 23
HIRL Rwy 5-23 and 14-32

BUFFALO, NEW YORK

Orig-B 13SEP18

42°56'N-78°44'W

BUFFALO NIAGARA INTL (BUF)

RNAV (RNP) Z RWY 23

NE-2, 16 MAY 2024 to 13 JUN 2024