

APP CRS
243°

Rwy Idg
TDZE
95
Apt Elev
96

2868

RNAV (GPS) RWY 24

FULLERTON MUNI (FUL)

RNP APCH.


▼

NA

Inoperative table does not apply.
Helicopter visibility reduction below 1 SM NA.

MISSED APPROACH: Climb to 1300, then climbing left turn to 2600 direct SUI VORTAC and hold.

ATIS 125.05	SOCAL APP CON 125.35 316.125	FULLERTON TOWER ★ 119.1 (CTAF) 0	GND CON 121.8	UNICOM 122.95
----------------	---------------------------------	-------------------------------------	------------------	------------------

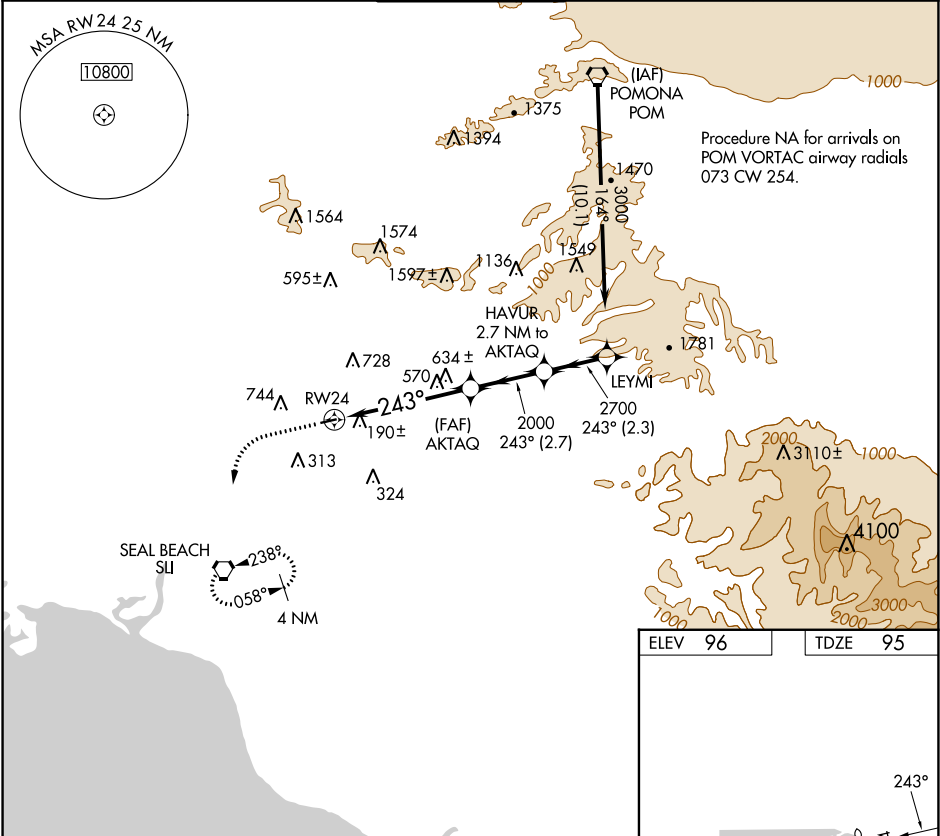

1300

2600

SUI

VGSI and descent angles not coincident
(VGSI Angle 4.00/TCH 33).

RWY 24

AKTAQ

HAVUR
2.7 NM to
AKTAQ

LEYMI

3000

2700

243°

2000

Procedure
Turn
NA

5 NM

2.7 NM

2.3 NM

CATEGORY	A	B	C	D
LNAV MDA	900-1 805 (900-1)	900-1¼ 805 (900-1¼)	NA	

ELEV 96

TDZE 95

3121 X 75

0.3% UP

TWR 158

243°

24

MIRL Rwy 6-24

REIL Rws 6 and 24

RLS Rwy 24