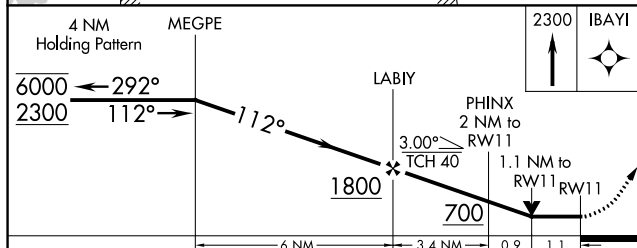
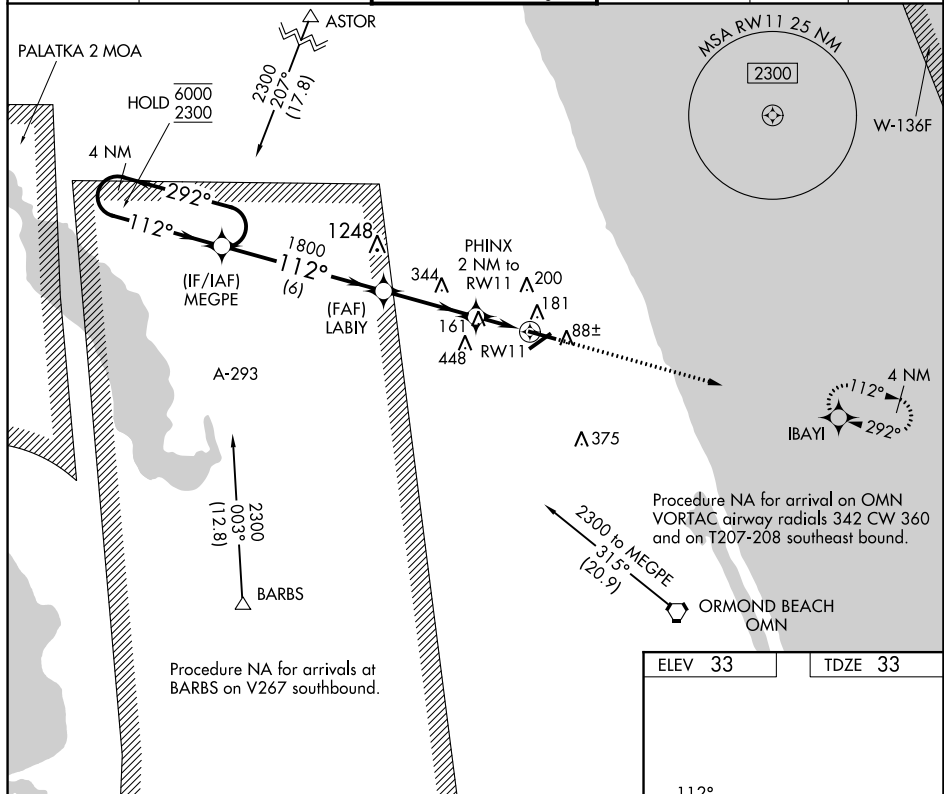


23110


RNAV (GPS) RWY 11
FLAGLER EXEC (FIN)

T Circling NA to Rwy 18W and 36W.
A Rwy 11 helicopter visibility reduction below $\frac{3}{4}$ SM NA.

MISSED APPROACH: Climb to 2300 direct IBAYI and hold.

UNICOM
123.0

CATEGORY	A	B	C	D
LP MDA	420-1	387 (400-1)	420-1 $\frac{1}{8}$	387 (400-1 $\frac{1}{8}$)
LNAV MDA	540-1	507 (600-1)	540-1 $\frac{3}{8}$	507 (600-1 $\frac{3}{8}$)
C CIRCLING	540-1	507 (600-1)	760-2 727 (800-2)	760-2 $\frac{1}{4}$ 727 (800-2 $\frac{1}{4}$)

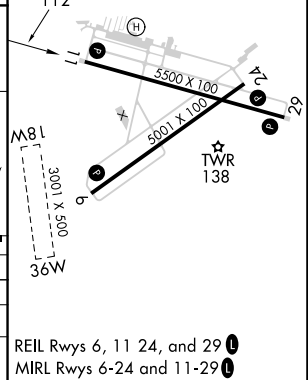

FLAGLER EXEC (FIN)
RNAV (GPS) RWY 11