


APP CRS	Rwy Idg	5022
020°	TDZE	3090
	Apt Elev	3090

RNAV (GPS) RWY 2

MAJOR SAMUEL B CORNELIUS FLD (E42)

▼ DME/DME RNP-0.3 NA. Visibility reduction by helicopters NA. Use Borger altimeter setting; when not received, use Rick Husband Amarillo Intl altimeter setting and increase all MDA 140 feet, increase LNAV Cat B visibility ¼ mile, LNAV Cat C visibility ½ mile, Circling Cat A visibility ¼ mile, and Circling Cat C visibility ½ mile.	⚠ NA	MISSED APPROACH: Climbing left turn to 6000 direct OYUSA hold.
---	--------------------------------------	---

AWOS-3P 118.925	ALBUQUERQUE CENTER 127.85 285.475	CTAF 122.9
--------------------	--------------------------------------	---------------

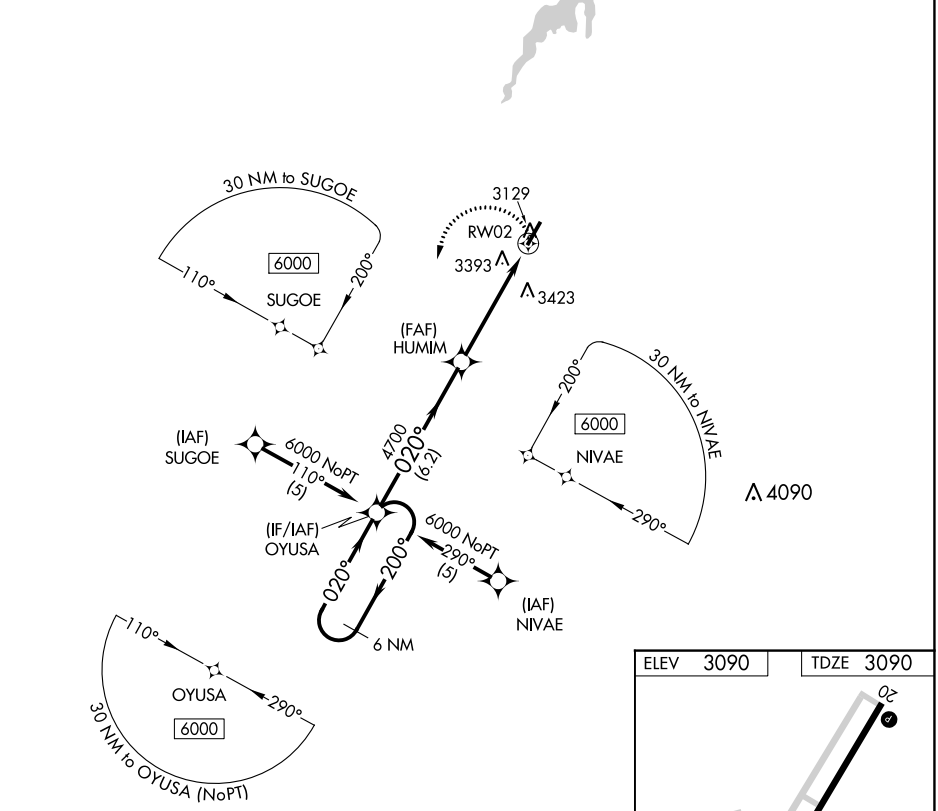

6 NM Holding Pattern		VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 39°).		6000	OYUSA
← 200°		020° →		HUMIM	
6000		020°		3.04° TCH 40°	
4700		RW02		6.2 NM	
6.2 NM		4.9 NM		CATEGORY	
A		B		C	
LNNAV MDA		3780-1 690 (700-1)		3780-2 690 (700-2)	
CIRCLING		3840-1 750 (800-1)		3840-2 750 (800-2)	
		3840-1¼ 750 (800-1¼)		3840-2¼ 750 (800-2¼)	
				NA	

