

WAAS CH 63142 W16A	APP CRS 161°	Rwy Idg TDZE 9934 Apt Elev 9934
--	------------------------	---

RNAV (GPS) RWY 16


LAKE COUNTY (L.XV)

RNP APCH+GPS.


Baro-VNAV NA.
When local altimeter setting not received, procedure NA.

MISSED APPROACH: Climb to 16000 direct MORYU and on track 142° to LOZUL and hold, continue climb-in-hold to 16000.
#Missed approach requires minimum climb of 240 feet per NM to 12500.

ASOS 118.375	DENVER CENTER 119.85 363.15	UNICOM 122.8 (CTAF) 0
------------------------	---------------------------------------	---------------------------------

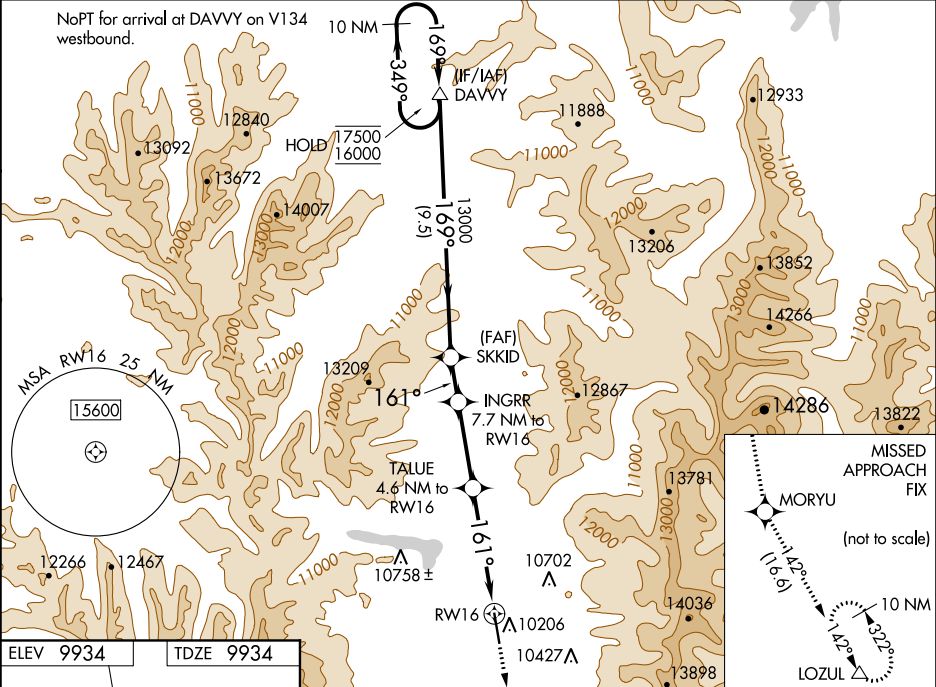

ELEV 9934	TDZE 9934
-----------	-----------

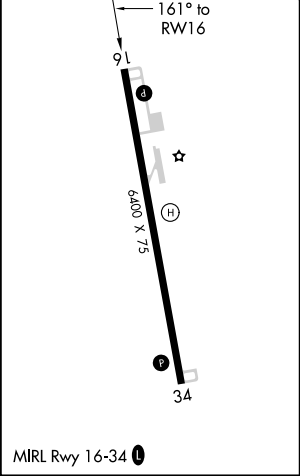

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 45).

10 NM Holding Pattern DAVVY

GP 3.04° TCH 51

17500 16000 13000 12460 11440

349° 169° 169° 161°

9.5 NM 1.6 NM 3.1 NM 2.2 NM 2.4 NM

CATEGORY	A	B	C	D
LPV DA#	10184-1	250 (300-1)		NA
LPV DA	10546-1¾	612 (700-1¾)		NA
LNAV/VNAV DA	10542-1¾	608 (700-1¾)		NA
LNAV MDA	10740-1 806 (900-1)	10740-1¼ 806 (900-1¼)	10740-2½ 806 (900-2½)	NA
CIRCLING	10740-1 806 (900-1)	11040-1½ 1106 (1200-1½)	12020-3 2086 (2100-3)	NA